

- 940nm 300mW 60°C, FFV 18º
- Infrared Laser Sep. 2019 (Ver. 1)

Application

- Sensor
- Industrial optical module

• Features

- 940nm Infra Red Laser
- CW laser (Continuous Wave)
- Single Transvers / TE mode laser
- 5.6mm Package

• Electrical Connection

P/N	Pin Configuration	Internal Circuit			
QL94R6SA/B/C-S	Bottom View 0.5±0.1 3 0.2 2 2.0±0.15	3.PD 1.LD 3.PD 1.LD 2.COMMON A type 3.PD 1.LD 2.COMMON C type			



1. ABSOLUTE MAXIMUM RATING

Item	Symbols	Values	Unit
Optical Output Power	P	300	mW
Laser Diode Reverse Voltage	V	2	V
Photo Diode Reverse Voltage	V	30	V
Operating Temperature	$\mathrm{T_{opr}}$	-10 ~ +60	$^{\circ}$
Storage Temperature	${ m T_{stg}}$	-40 ~ +85	$^{\circ}$

2. ELECTRICAL and OPTICAL CHARACTERISTICS at Tc=25°C


Item	Symbol	Min	Тур	Max	Unit	Condition
Threshold Current	$ m I_{th}$	-	50	80	mA	-
Operating Current	I_{op}	-	400	450	mA	Po=300mW
Operating Voltage	V_{op}	-	2.0	2.5	V	Po=300mW
Slope Efficiency	η_{s}	0.5	0.8	1.1	mW/mA	Po=300mW
Lasing Wavelength	$\lambda_{ m p}$	930	940	955	nm	Po=300mW
Beam Divergence	θ_{II}	4	8	12	deg	Po=300mW FWHM
	θ_{\perp}	12	18	24	deg	
Beam Angle	$\Delta heta_{ m II}$	-3	-	+3	deg	Po=300mW
	$\Delta heta_{\perp}$	-3	-	+3	deg	Po=300mW
Monitor Current	I_{m}	0.1	0.5	1.5	mA	Po=300mW
Optical Distance	$\Delta X, \Delta Y, \Delta Z$	-80	-	+80	μm	-

Note: Tc = Case (Stem) temperature

- Use in APC condition with heat sink and do not exceed 300mW $60\,^{\circ}$ C
- The products and product specifications are subject to change without notice.




3. PACKAGE DIMENSION (unit: mm)

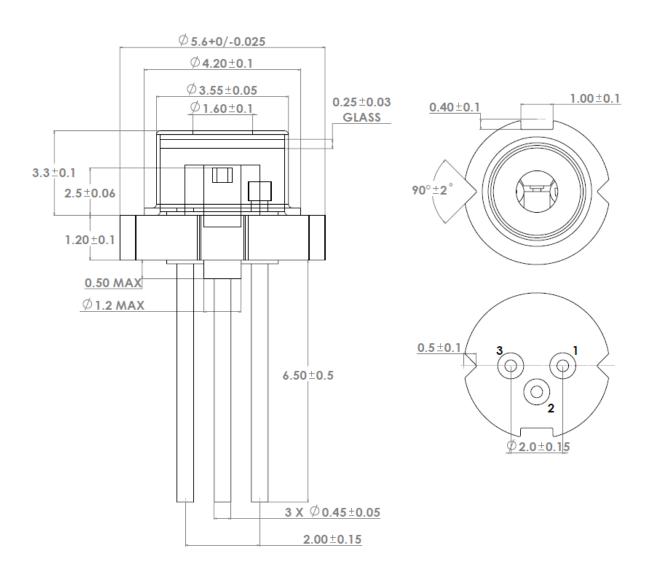


Note : Tolerance is ± 0.05 mm for items without tolerance marking



4. PACKING

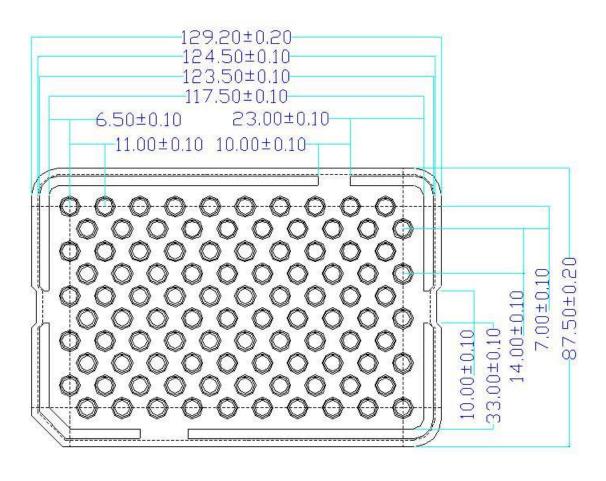

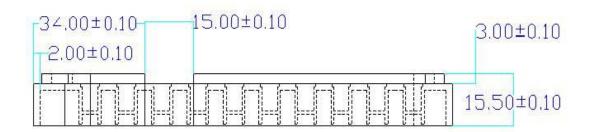



5. PRECAUTIONS

1) Absolute maximum ratings

The absolute maximum ratings which must not be exceeded even momentarily have been established for over driving laser operation reason such as COD. Exercise particular caution with respect to the drive voltage supply and static electricity.

2) Prevention of surge current and electrostatic discharge(ESD) and surge stress

Laser diode is sensitive device to ESD and surge, so even an extremely short time, laser diode damaged with the strong light emitted.

Use the power supply that was designed not to exceed the optical power output specified at the absolute maximum ratings

We advise talking the following protective measures

- -. Ground the device and circuits
- -. When working with laser diodes wear anti-static clothing.

 Grounded wrist straps should always be worn while working with laser diodes.
- -. Use anti-static containers for transport and storage.
- -. Laser diode deterioration and damage can occur due to excessive current spikes when the power is turned on or off.

Design circuits to avoid the generating of excessive current spikes

3) Soldering

When soldering, please give attention to the mechanical stress and the temperature. Temperature of die-pad portion should be less than 200°C. It is recommended to radiate heat by putting heat sink on the package.

* Soldering temperature and time: Iron temperature less than 350°C within3sec (leads only)

4) Eye Safety

When the laser diode is in operation, looking into laser beam directly by naked eyes, even through a lens, microscope or optical fibers, may cause severe damage to human eyes. For observing laser beams, using safety goggles is recommended